

Polish Report

After the model was scanned and built with reflect, you can create a *Polish Report* for it.

On this page:

1

[Accessing Polish Report](#)

2

[Preparing to Make Report](#)

2.1

[General Settings](#)

2.2

[Specifying Facet Marking](#)


3

[Making Report](#)


Accessing Polish Report

The **Polish Report** can be accessed in one of the following ways:


Select **Polish report** from the **Reports** section of the right panel,

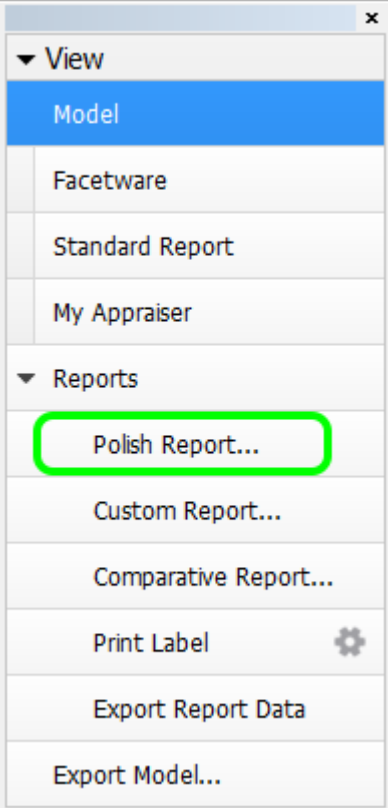


select **File - Create polished report** from the top menu,

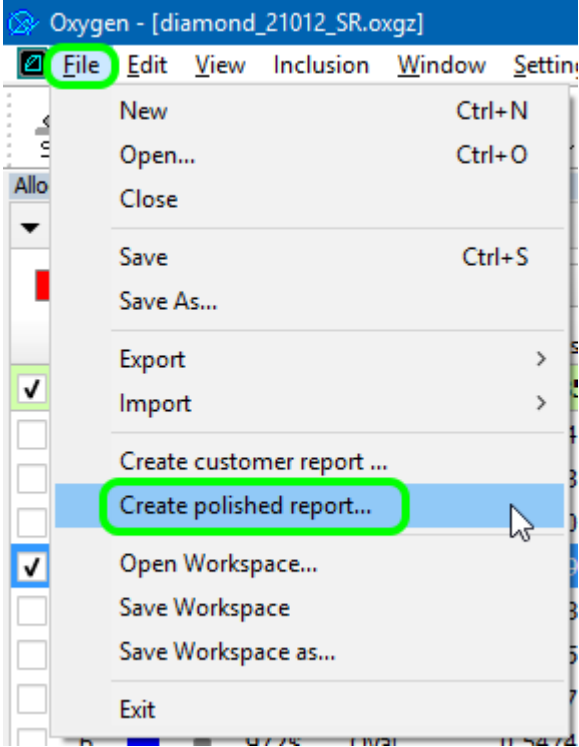


or press **Polish report** button in the **Plans & Scans** panel.

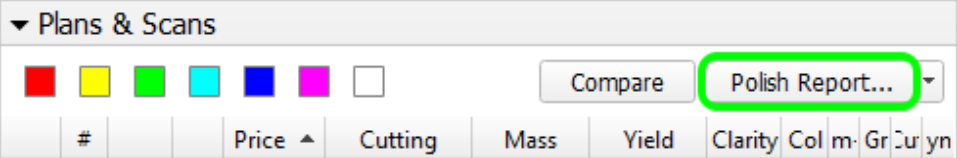

 Note that the latter button is multi-optional. The dropdown list to the right provides a selection of options: **Standard Report**, **Polish Report**, **Custom Report**, and **Print Label**. Once selected, the option persists until the program is closed or a new model is opened.

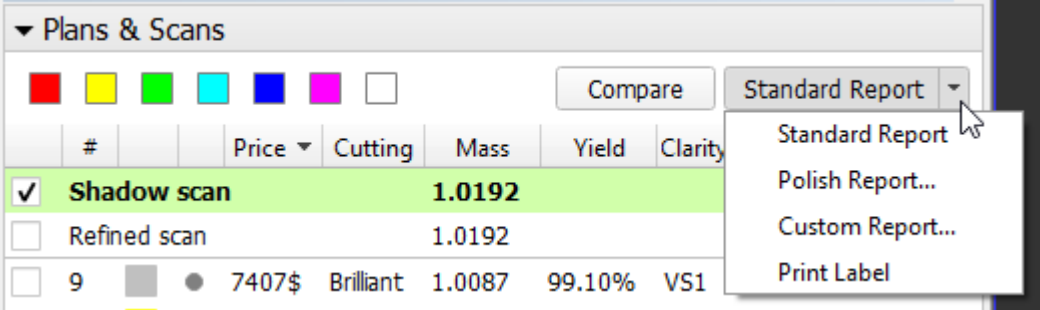

Preparing to Make Report

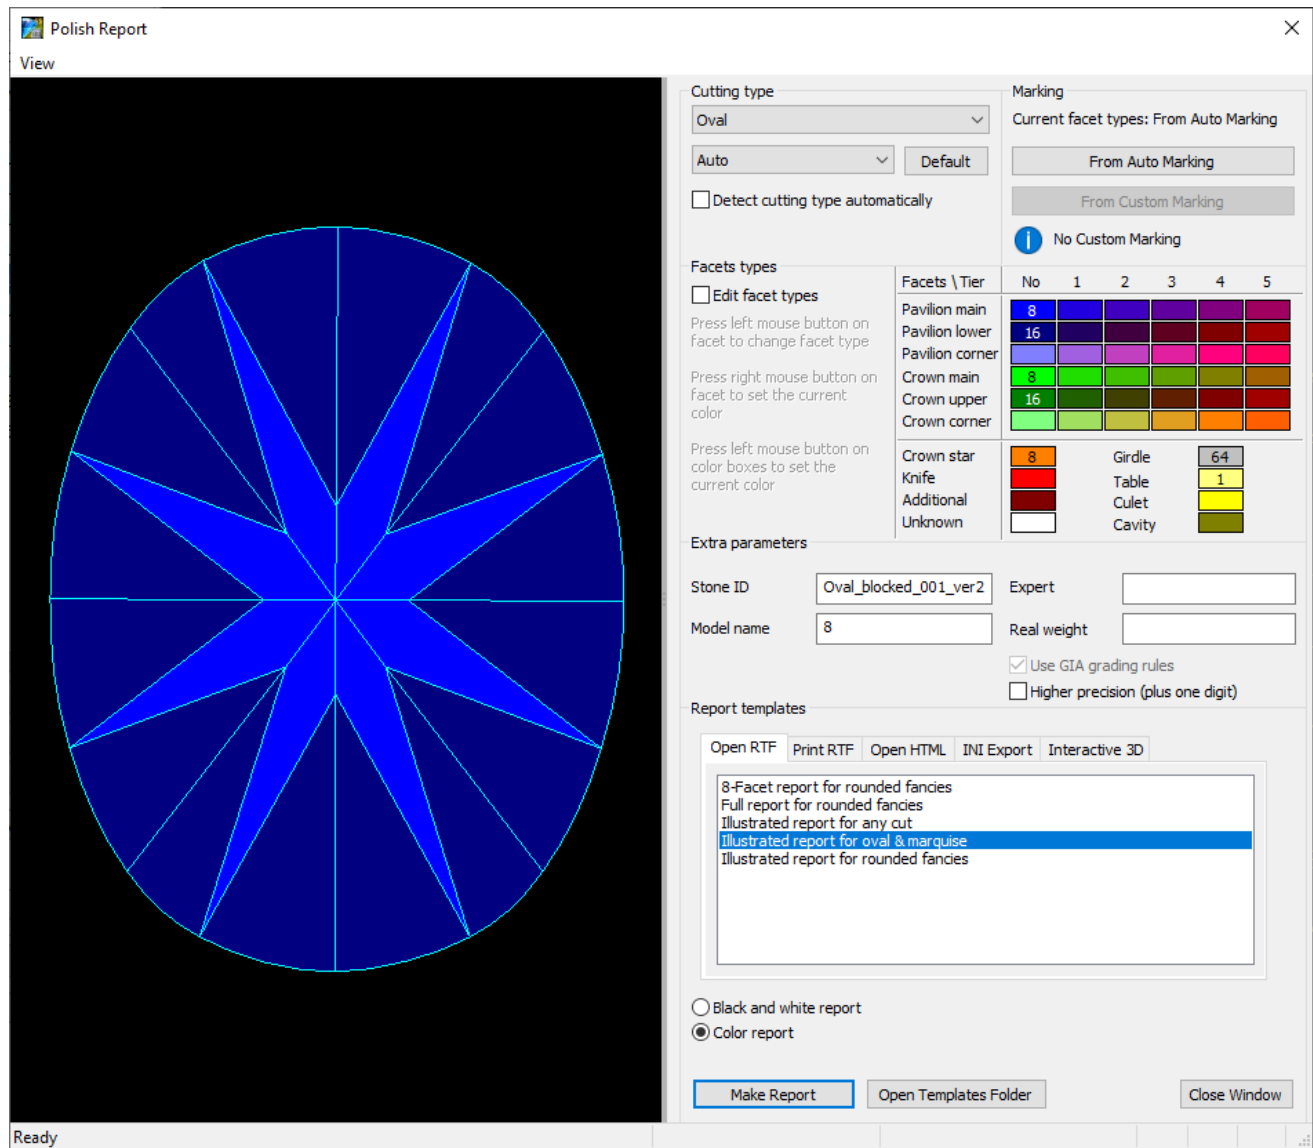

In the Polish Report window, before making a report, you can specify its general settings and specify facet marking to be used.

General Settings

In the Polish Report window, you can set the following general settings:

1. Set the cutting type (initially it is assigned automatically).

⚠ The incorrect cutting type would result in a report with multiple inconsistencies, missing parameters, and poor grades.


2. Edit facet types, if you need (normally these are assigned automatically, too; if you want more flexibility in dealing with facet types, for example when evaluating a non-standard cut, consider using [custom report](#) instead).
3. Specify the extra parameters, if needed:
 - a. Stone ID (normally assigned to stone during scanning)
 - b. Model name (normally assigned automatically)
 - c. Expert name
 - d. Real weight
4. Make the following settings, if needed:
 - a. Use GIA grading rules
 - b. Higher precision (plus one digit)

⚠ The extra parameters and settings are not persistent. If you close and reopen the report window, they revert to their default values.

5. Select the report type and template. The choice of the report template depends on the report type and the particular cut.

Specifying Facet Marking

Sometimes, the custom facet marking of a model (if it has this marking) may differ from the facet marking applied to the model in Polish Report (Auto Marking). The Polish Report dialog provides you information about this difference and allows to select which marking to use in the report.

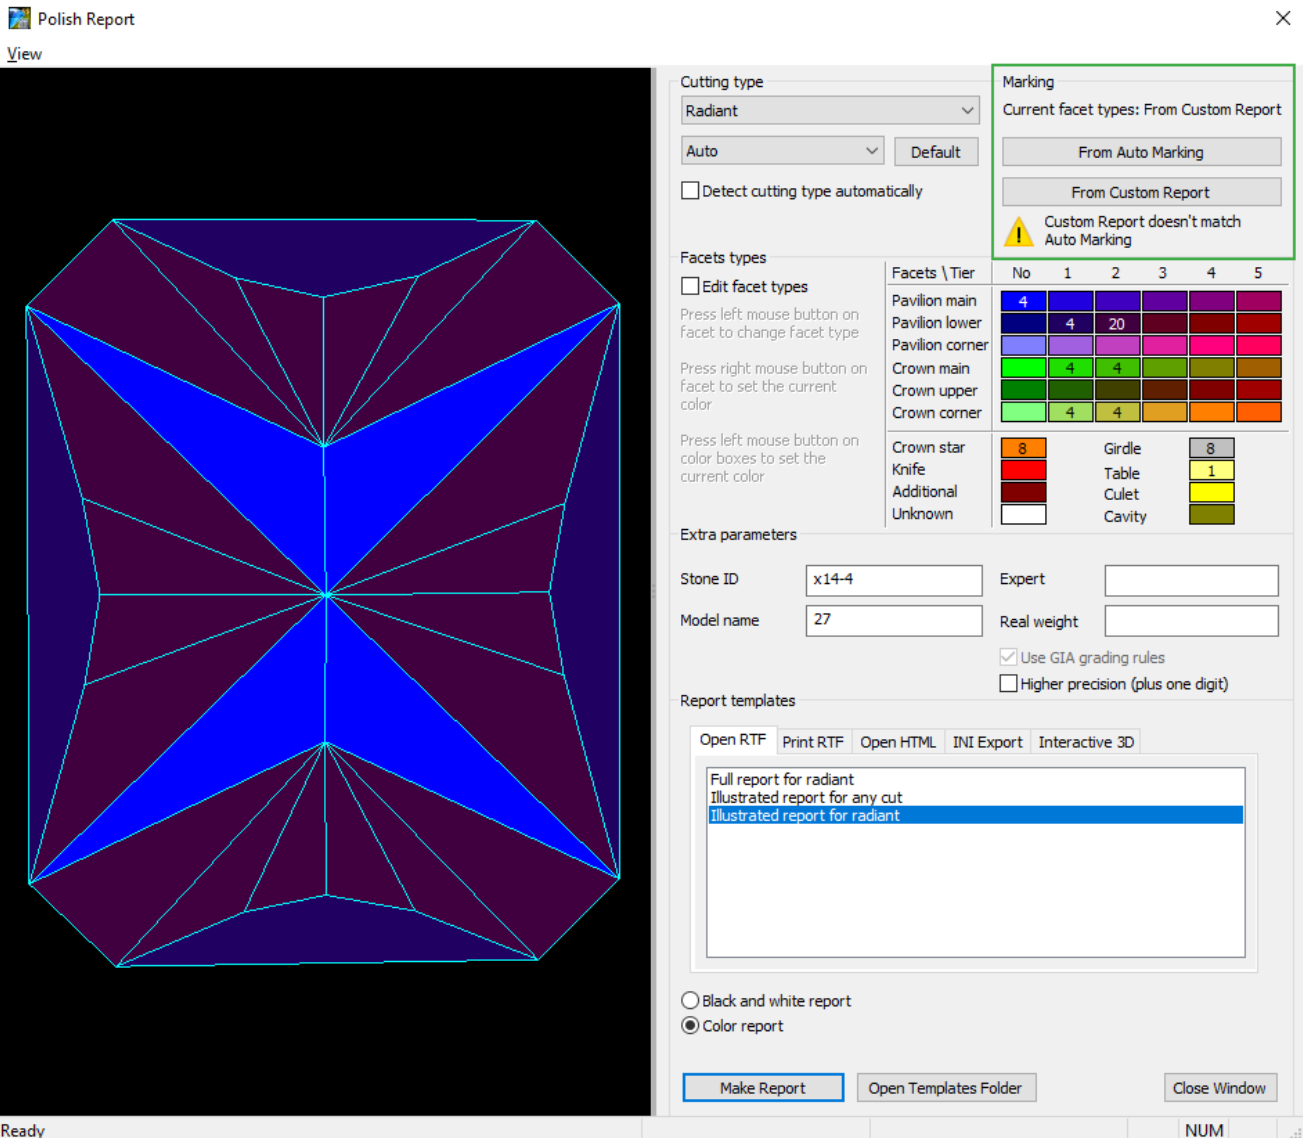

- If the custom facet marking differs from Auto Marking, the custom will be applied by default.
- To change the marking, in the **Marking** section, click **From Auto Marking** or **From Custom Report**. The **Current facet types: From ...** will change; the **View** will be updated.
- To edit facet types manually, select the **Edit facet types** checkbox, in the **Facets\Tier** table, select the required type, then in the **View**, click the facet(s) to belong to the type. The **Current facet types:** will change to **Manual**.
- If there is no custom facet marking, the Auto Marking will be applied.

No custom marking	Markings identical	Markings differ	
Marking Current facet types: From Auto Marking From Auto Marking From Custom Report ! No Custom Report	Marking Current facet types: From Auto Marking From Auto Marking From Custom Report ✓ Custom Report matches Auto Marking	Marking Current facet types: From Custom Report From Auto Marking From Custom Report ! Custom Report doesn't match Auto Marking	Marking Current facet types: Manual From Auto Marking From Custom Report ! Custom Report doesn't match Auto Marking

Making Report

When you are done with settings, press **Make Report**. Depending on the report type, one of the following actions will occur:

Type	Action
------	--------

