## 2015.10.23 - Helium Polish version 5.6.79.1, report.dll version 2.7.3.1, BrilRecon.dll version 1.1.12.1, OHWS\_reflect2.dll 1.5.63.533, new templates dd 15.09.2015

Release contains:

File	Version			
HeliimPolish.exe	5.6.79.1			
report.dll	2.7.3.1			
BriRecon.dll	1.1.12.1			
OHWS_Reflect2.dll	1.5.63.533			
Reports templates	2015-09-15			

In this version we made following changes:

1. New cutting type "HEART" to differ from Pear.

2. Improvement of "TRIANGLE" determination. We still are working under correct width/length and table width/length calculation- this will be added in next version.

- 3. New parameter ALN (bookmark GIA\_ALN\_DEG) is added to reports. Following parameters were renamed:
  - a. Girdle Bezel Alignment -> Junction Bezel Twist (bookmarks JUNCTION\_BEZEL\_TWIST\_MM\_..., JUNCTION\_BEZEL\_TWIST\_DEG\_...)
  - b. Girdle Bone Alignment -> Junction Bone Twist (bookmarks JUNCTION\_BONE\_TWIST\_MM\_..., JUNCTION\_BONE\_TWIST\_DEG\_...)


b. Girdle Bolle Angimient -> Sunction Bolle Twist (bookmarks Solve Front\_Bolle\_Twist -> Facet Twist (bookmarks FACET\_TWIST\_DEG\_...)
d. Virtual table edge -> Table Edge (TEV) (bookmarks TEV\_TABLE\_EDGE\_MM\_..., MODEL\_TABLE\_EDGE\_PC\_...)
e. Table edge -> Model Table Edge (bookmarks MODEL\_TABLE\_EDGE\_MM\_..., MODEL\_TABLE\_EDGE\_PC\_...)

Please find new report templates in zip. Old bookmarks are deleted from new templates but software will work both with new bookmarks and old bookmarks co now booke

we recommend to use new bookmarks.							
Parameter		Avg	Min	Max	Dev	Cut	Sym
Misalignment (ALN)	0	1.9276					
Junction Bezel Twist	0	0.4885	-1.6073	1.9276	3.5349		
Junction Bezel Twist	mm	0.02847	-0.09373	0.11226	0.20600		
Junction Bone Twist	0	0.4449	-0.4161	0.9295	1.3456		
Junction Bone Twist	mm	0.02597	-0.02423	0.05414	0.07837		
Model Table Edge	%	21.8080	21.2025	22.1653	0.9628		
Model Table Edge	mm	1.46201	1.42142	1.48597	0.06455		
Table Edge (TEV)	%	22.0282	21.5549	22.3448	0.7899		
Table Edge (TEV)	mm	1.47678	1.44505	1.49800	0.05296		


4. Wrong determination of some samples as Pear instead of Oval is fixed. The project build under "P-O-M-H-R" and report type as "Auto" software automatically recognize in one mmd as "Pear" and in another mmd as "Cushion".

- 5. Some other improvements of determination of facets type for RBC.
- 6. Problem with missing values for Cushion in Grouping pictures is fixed:

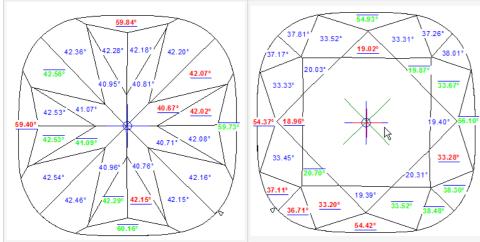


7. Problem with visible and invisible edges color is fixed. Visible edges had same color with invisible edges in report.dll 2.6.11.1. Fixed in report.dll 2.7.3.1:

Report.dll 2.7.3.1	Report.dll 2.6.11.1
--------------------	---------------------

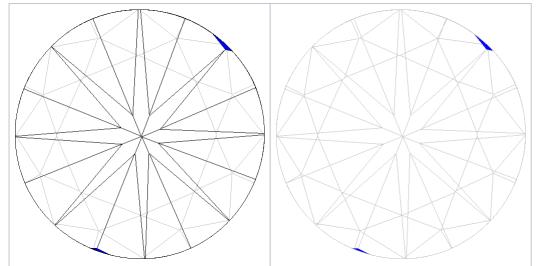



8. Change in calculation of "ideal" position for pictures «Pavilion/crown painting and deviation of pavilion/crown main facets azimuths angles from their ideal positions for the round brilliant". Before there was standard "net" 0, 45, 90, 135,....,315 degrees for "ideal" position. From this version program calculates position to minimize means-square deviation and to have as more as possible deviations which are closed to «0». Changes are visible in Full report for bookmarks PAVILIONAZIMUTHDEV\_REPORT\_COLOR, PAVILION\_AZIMUTH\_DEV\_PICTURE, CROWN\_AZIMUTH\_DEV\_PICTURE.

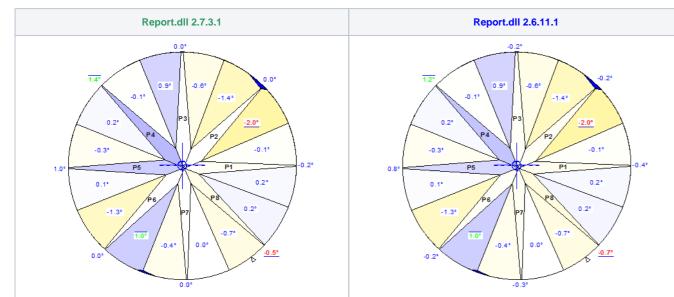

On example below, 4 facets deviations are equal to «0»:

9. Bug with wrong detection of semi-polished Heart is fixed. In previous version (report.dll 2.6.11.1) semi-polished heart was recognized as Oval cut. From current version (report.dll 2.7.3.1) semi-polished heart is recognized as Heart cut. 10. Culet determination is changed to fix problem where extra-facet was determined as culet (extra facets are indicated in red color, culet facets are indicated in yellow color, culet center is indicated as red cross).

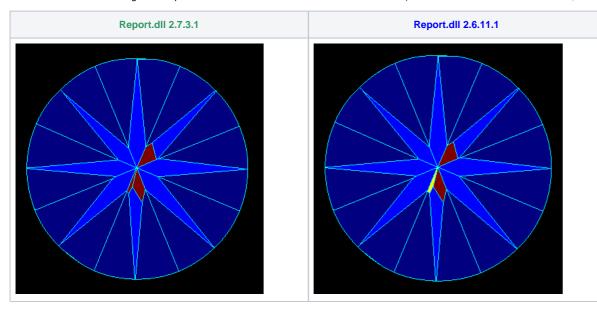

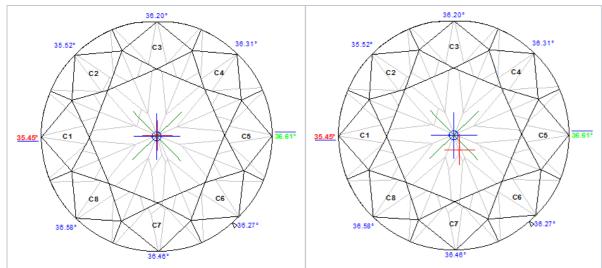

11. Bug with export of DMC from HPP is fixed. There was error when exported to DMC file model has table azimuth and slope do not equal to zero.

